

Ecessa Firmware Release Notes

Version: 12.1.2

Release: 2023.02.28

Revision 1.0: 2023.02.28

Fixes

WAN Virtualization

- **Device may go through a reboot if a WAN Virtualization configuration has an out of date setting**

Additional Information

The device may see a kernel report or experience a reboot if the reorder-timeout setting is set to anything greater than 0. This setting was used for older versions for current versions it is no longer relevant and will be removed

Workaround

In the CLI change the WV reorder-timeout back to the default:

```
wanvirt set reorder-timeout 0; commit save;
```

Diagnostics

- **Diagnostics Traffic Utility shows no information when the following is selected: All Ports**

Update

- **Hardware Failover will cause unnecessary fail overs after upgrade on 12.1.0 and 12.1.1**

Additional Information

If upgrading from 12.1.1 or 12.1.0 using the Idle upgrade method, then the following method MUST be followed to prevent unnecessary failovers:

- * Primary is Active on (12.1.1 or 12.1.0)
- * Secondary is IDLE
- * Update the Secondary to the new version
- * After upgrade, perform a force failover to make the Secondary Active
- * Update the Primary (Idle) to the new version.